

4121V21

DOC. #


~~0046023~~

FLORIDA DEPARTMENT OF NATURAL RESOURCES
CERTIFIED CORNER RECORD

V-21

CORNER DESCRIPTION:

S.E. corner of Section 26 ,
Twp 41 S. , Rge 21 E. ,
Tallahassee Base Meridian,
CHARLOTTE County(s), Florida.

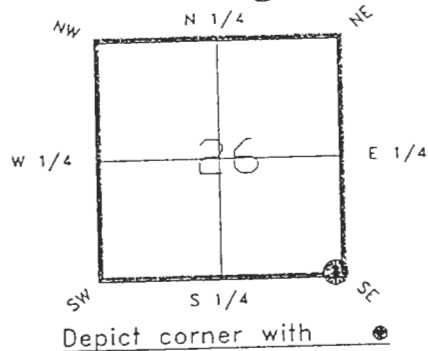

MONUMENTATION DESCRIPTION:

Describe original monument and accessories, or subsequent restoration. Give sources of information. (If no attempt was made to search for the original monument and accessories, this information is not necessary.)
NONE FOUND

Description of corner evidence found:

4" X 4" CONCRETE MONUMENT AT GROUND LEVEL

RECEIVED

JUL 26 1993

State method(s) to determine corner location (lost corners only):

SURVEY & MAPPING

HORIZONTAL POSITION INFORMATION (if determined):

Latitude 26°52'20.25676"N Longitude 82°10'29.17610"W
Y(Northing) 281266.659(M) X(Easting) 182634.563(M) Zone FL W
Convergence -0°04'44.390" Scale factor 0.99994490

Coordinate determination (circle one): Field traverse GPS

Horizontal datum (circle one): NAD27 NAD83(1986) NAD83(1990) other (explain)

Order of accuracy as defined in "Standards and Specifications for Geodetic Control Networks" published by the Federal Geodetic Control Committee (circle one):
1st 2nd 3rd, class 1 ,


or Minimum Technical Standards (Chapter 21HH-6, F.A.C.) ratio of closure for field data (example 1:10,000), _____ . This does not specify an order of accuracy.

Control point(s) used for survey:

Comments:

PLEASE SEND ORIGINAL ONLY
PLEASE COMPLETE IN BLACK INK OR TYPE

DNR 53-001(16)
REV: 7/16/92
PAGE 1 OF 2

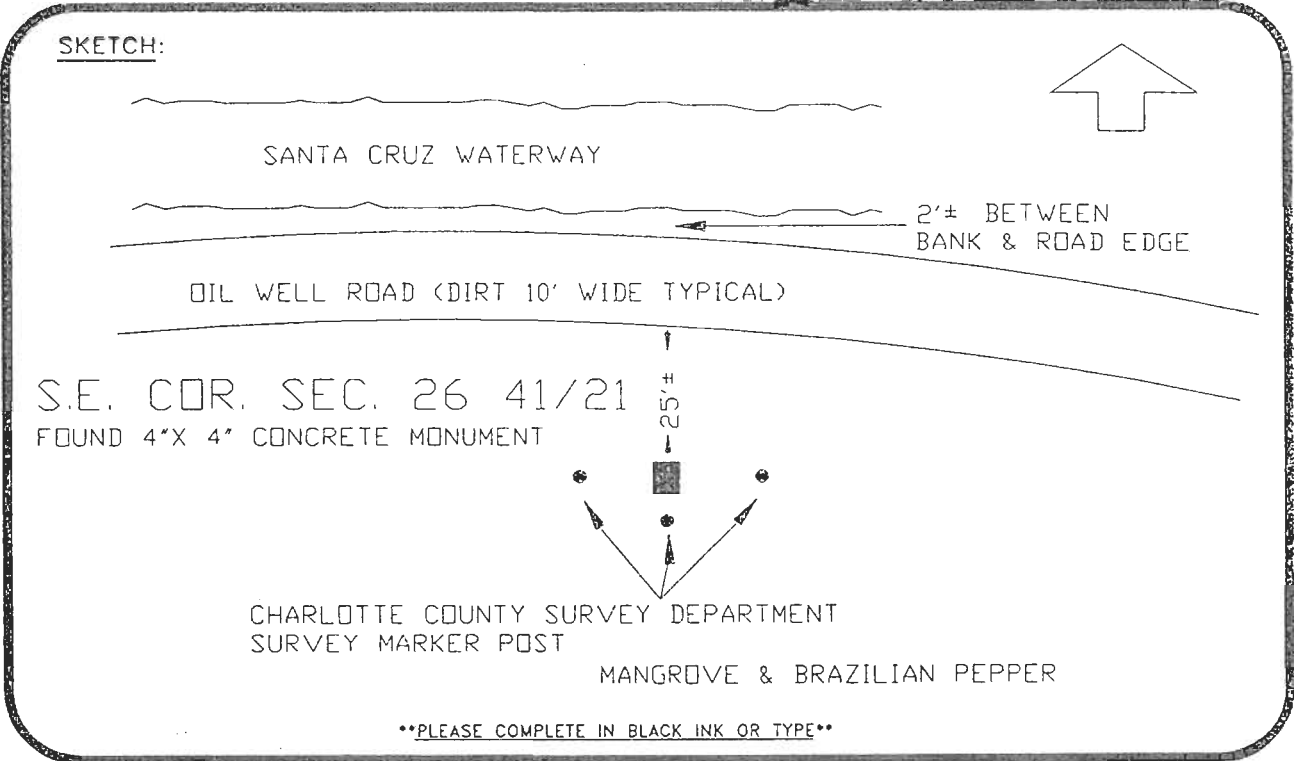


BASIS OF BEARING—COMPASS MAG. BEARING REFER:F.B. 274-20
 All bearings and distances must be from the corner to the witness. Indicate whether corner was found, set, or replaced and show north arrow.

REFERENCE MEASUREMENTS (at least three vicinity references must be given below even if they appear on the above sketch):

| Description | Bearing | Distance |
|--------------------|---------|----------|
| SURVEY MARKER POST | WEST | 11.0' |
| SURVEY MARKER POST | SOUTH | 5.0' |
| SURVEY MARKER POST | EAST | 11.0' |

SURVEYORS CERTIFICATE: I certify the monument and accessories indicated above were field located on DECEMBER 17, 1991.

[Signature] PLS 4260
SIGNATURE
July 12, 1993
DATE
 CHARLOTTE COUNTY SURVEY DEPT.
FIRM OR AGENCY
 7000 FLORIDA STREET
ADDRESS
 PUNTA GORDA, FLA. 33950
CITY STATE

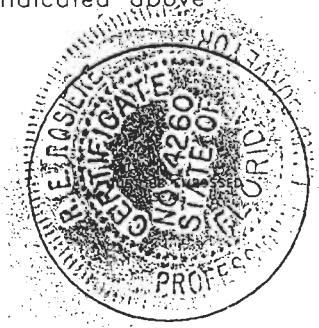

Completeness checked by: GR Green
 Accepted and filed: 8-93 Date
 B.L.M. - I.D. 35262536 D.N.R. USE ONLY

SEND TO:
 Department of Natural Resources
 Bureau of Survey and Mapping
 3900 Commonwealth Boulevard
 Mail Station 105
 Tallahassee, Florida 32399
 DNR 53-001(16)
 REV. 7/16/92
 PAGE 2 OF 2